Installation Guide

NEWSTAR computerproducts

www.newstar.nl

LCD & PLASMA TV/Monitor wallmount

Model:
PLASMA-W400

Installation guide



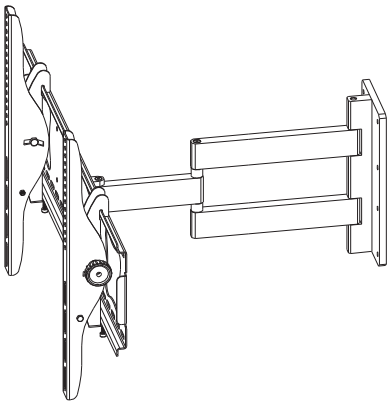



PLASMA-W400

6 - 56 cm

EXPLODE DRAWING

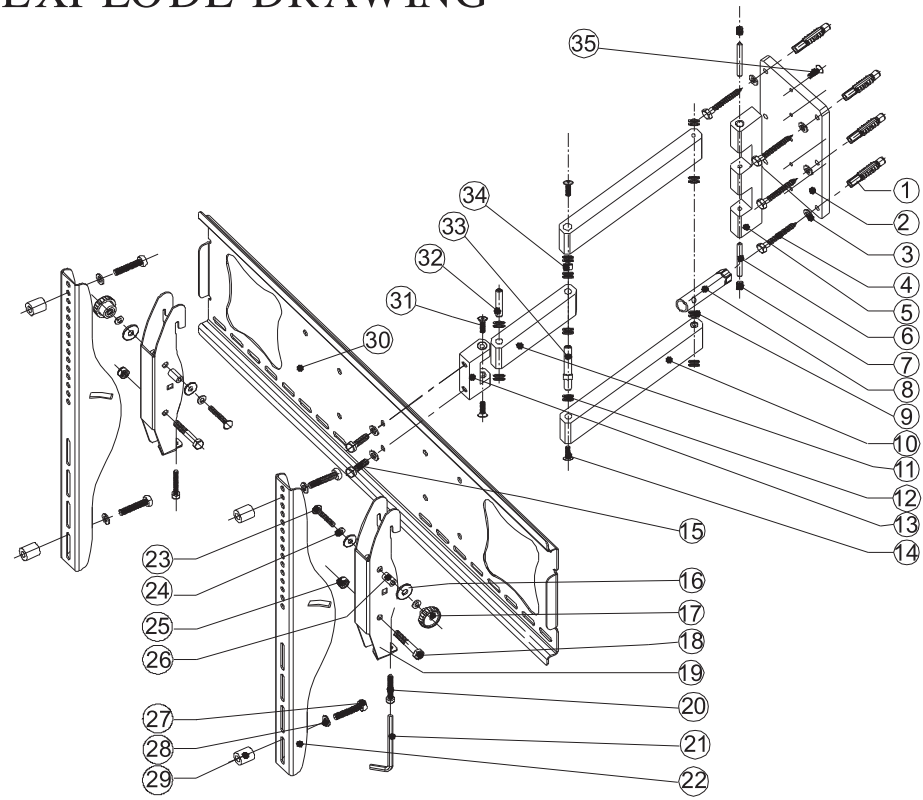

CAUTION: Do not exceed 75 *kilo* weight limit
LET OP: Maximaal draagvermogen 75 kilo

SPARE PART LIST

Serial No.	Part Name	Raw Material	Q'TY
1	Concrete Anchor	PA6	6
2	Wall Plate	Aluminium	1
3	ϕ8 Flat Plate	A3	8
4	Flat wood Screw	A3	6
5	Wall Pivot	Aluminium	1
6	Axis Bolt	A3	2
7	Bolt Head	A3/M12×10	2
8	Sleeve wrench	A3	1
9	Copper pad--a	H62	12
10	Arm	Aluminium	2
11	Arm	Aluminium	1
12	Copper pad--b	H62	8
13	Connector	Aluminium	1
14	Bolt	A3	2
15	Bolt	A3/M8×15	2
16	Plastic pad	PA6	4
17	Lock Washer	PP/H62	2
18	Bolt-e	A3/M8×50	2
19	Connection Bracket	SPCC	2
20	Bolt	M6×20	2
21	Allen Wrench	40#	1

Serial No.	Part Name	Raw Material	Q'TY
22	Monitor bracket	SPCC	2
23	Bolt	A3/M8×60	2
24	Φ8 Flat pad	PA6	4
25	M8 Nut	A3	2
26	Bolt Cover	PA6	2
27	Bolt-a	A3、M4×30	4
27	Bolt-b	A3、M5×30	4
27	Bolt-c	A3、M6×30	4
27	Bolt-d	A3、M8×25	4
27	Bolt-e	A3、M8×40	4
28	Flat pad	SPCC	4
28	Φ8 Flat pad	A3	4
28	Φ5 Flat pad	A3、M4×30	4
29	Plastic Pad-a	PP	4
29	Plastic Pad-b	PP	4
30	Monitor Plate	SPCC	1
31	Bolt	Stainless steel	4
32	Axis Bolt	A3	1
33	Axis Bolt	A3	1
34	Pad	A3	1
35	Bolt	Stainless steel	3

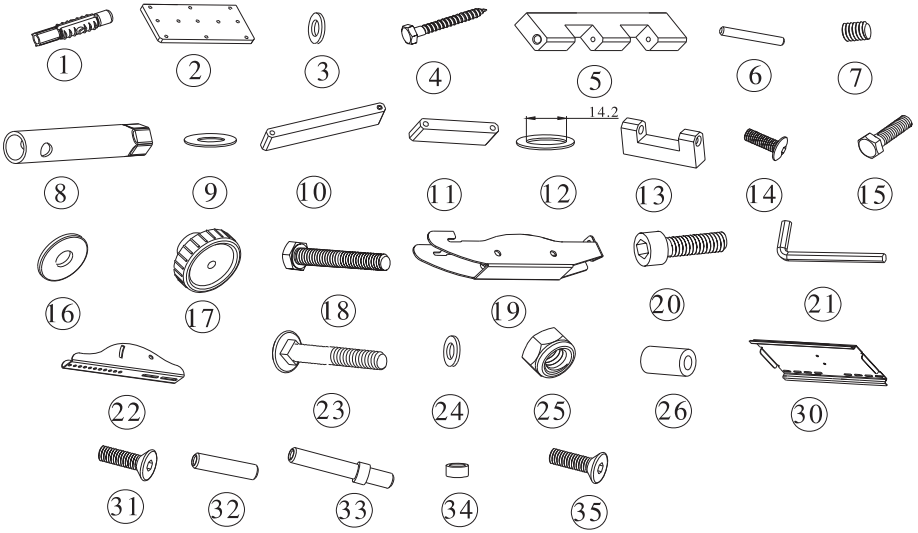

27					
28					
29					

CAUTION: Do not exceed 75 *kilo* weight limit
LET OP: Maximaal draagvermogen 75 kilo

Installation guide

1

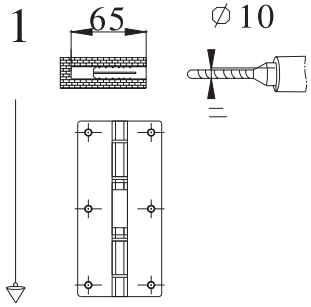

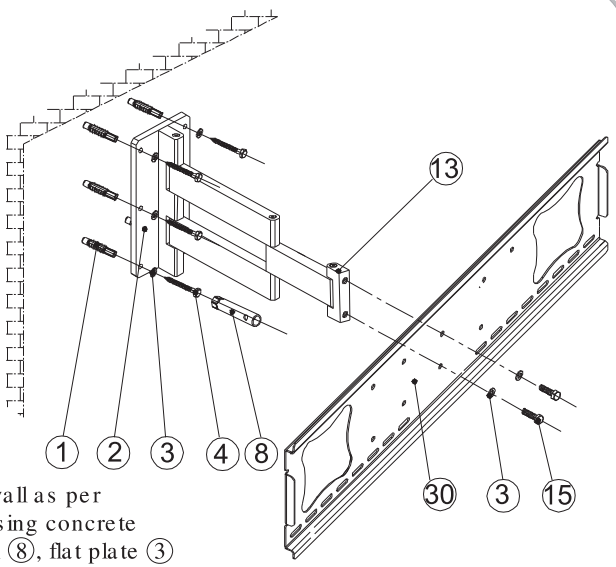

1. Put wall plate ② against the right place on the wall as per drawing.
2. Drilling / 10mm holes on the wall as per the hole of wall plate ②, encasing concrete anchor ①, using sleeve wrench ⑧, flat plate ③ and screw ④ to fix wall plate on the wall.
3. As per the drawing using the sleeve wrench ⑧, bolt ⑮ and flat plate ③ to fix monitor plate ㉚ on the connector ⑬.

2

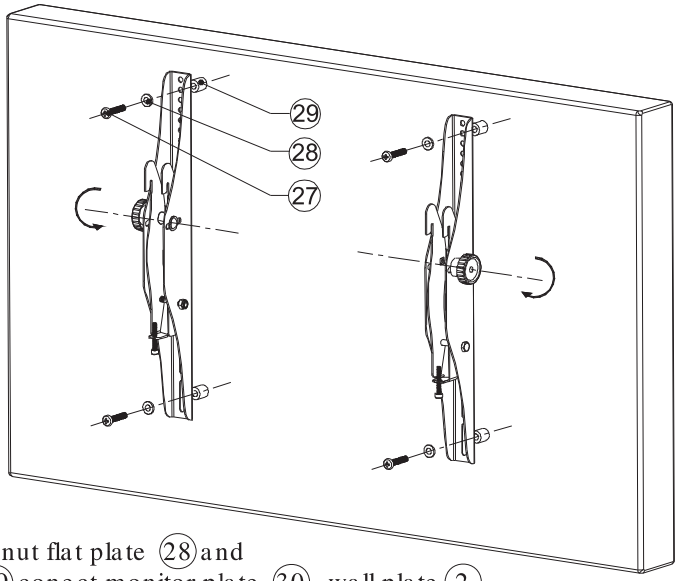

1. Use bolt ㉗, nut flat plate ㉘ and plastic pad ㉙ conect monitor plate ㉚, wall plate ②
   It must be firmness to fasten.

CAUTION: Do not exceed 75 *kilo* weight limit
LET OP: Maximaal draagvermogen 75 kilo

3

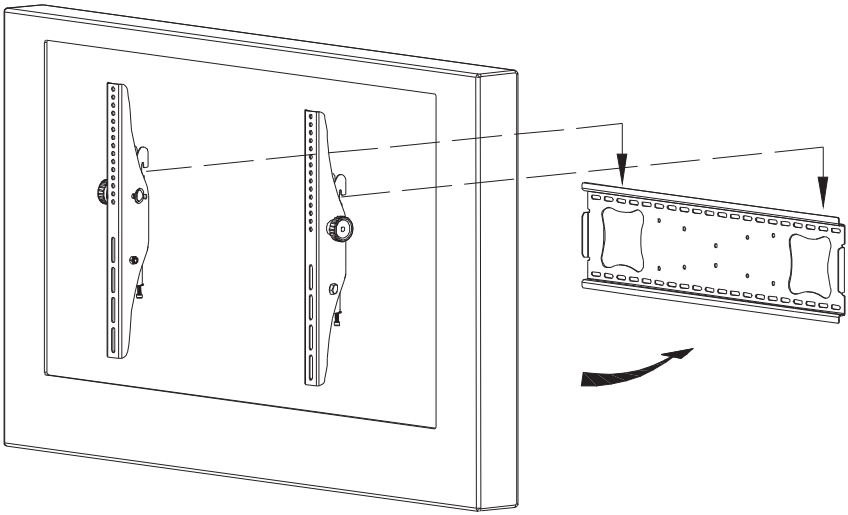

1.Hang up the well-assembling plasma monitor on the wall plate (Draw 1) in the place required.

4

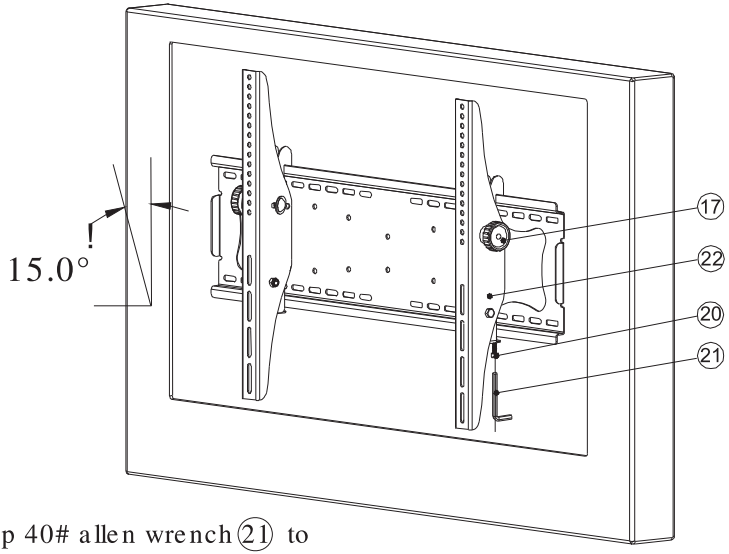

1.Using up 40# allen wrench (21) to spin bolt 20 into monitor bracket 22 and screw down.

2.Adjust suitable point of plasma viewing then tighten the lock washer 17 .

CAUTION: Do not exceed 75 *kilo* weight limit
LET OP: Maximaal draagvermogen 75 kilo

All Rights Reserved. Unauthorized Copying and Reproduction are prohibited.